


Mounting Instruction for F Self-install – TrueDrop™

Item no. 99909621, 99909631, 99909636

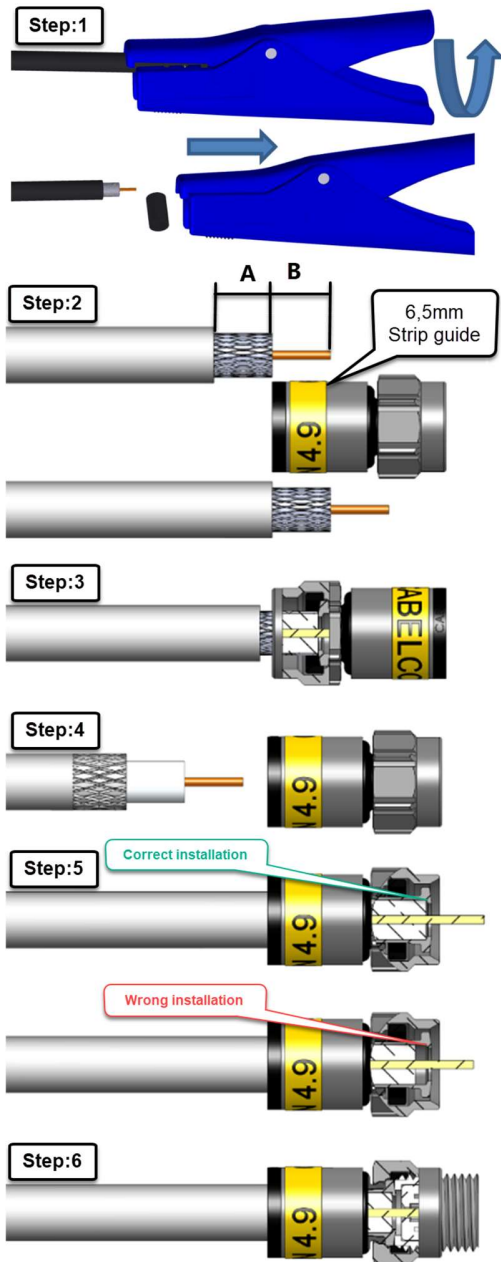

Step 1

Strip the cable.

Cut and remove the outer braid and foil. Leave only the first layer of braid (if needed, adjust cable stripper accordingly). Clean the cable inner and outer conductor with a conductor cleaner or any other appropriate equipment.

For your safety and best results Corning Cabelcon's pre-adjusted Cable Stripper is recommended.

Don't forget - read the enclosed user instruction before using the tool.

Step 2

Verify stripped dimensions by using cutting guide on the connector.

A = 6,5mm (outer conductor)

B = 6,5-8,0mm (inner conductor)

Step 3

optional option, press connector support sleeve back into connector, with light pressure for click, it will make cable installation easier (step 5).

Step 4

Brush / fold exposed braid back over jacket by using a stripping tool brush (if available) or any other nonmetallic brush.

Step 5

Push the connector over the foil, allow the support sleeve to slide between the foil and braid. Press and turn until the dielectric is flush with the support mandrel face.

For better connector and cable grip, Corning Cabelcon's connector mounting and cable rubber grip tool can be used.

Step 6

Compress the connector by tightening the connector on to the F female port.

Tools and Accessories	Item No.
CABLE STRIPPER ROTARY RG 6/59/MINI.	98501010
CABLE STRIPPER RG6/59 W. HEX 11 SPANNER	98501040-02
CABLE STRIPPER I/D RG6/59 WB FOR INDOOR PVC CABLE	98501083
CABLE CUTTER DROP RG59/6/11 CCS	98028619-01
CONDUCTOR CLEANER CC-200EUR	98500903
TORQUE WRENCH AH HEX 11mm 4,5NM	98029080-01
COLOR MARKING CX3. BLACK/BROWN/RED/ORANGE/YELLOW/GREEN/BLUE/VIOLET/GREY/WHITE/TURQUIS	990040**

© 2020 Corning Incorporated. All Rights Reserved.

ISO 9001 certified

CORNING

Corning Optical Communications ApS,
 Industriparken 10, DK-4760 Vordingborg
 Tel: +45 55 98 55 99 Fax: +45 55 98 55 04
 E-mail: cabelcon@corning.com www.cabelcon.dk